

Bronz-Glow's SPC-Clear Technical Data

Surface Preparation:

- Remove all traces of oil, grease, rust, dirt and dust
- Pressure rinse with a high pH cleaning solution
- Rinse with fresh water
- Pressure rinse with a low pH cleaning solution to reduce surface pH to 5.0 to 7.0
- Allow to air-dry thoroughly


RECOMMENDED EQUIPMENT SETTINGS:

Conventional and Air Assisted Spray Equipment

| | |
|------------------|--|
| Gun: | Binks model 2001 gun |
| Nozzle: | 63B |
| Cap: | 63PB or 66SD-3 for heavier build-up. (Do not dilute) |
| Needle: | 363A |
| Pressure to pot: | 25-30 psi |
| Pressure to gun: | 25-40 psi |
| Dilution: | Not required |
| Clean-up: | Bronz-Glow 15 Reducer |

Airless Spray Equipment

| | |
|---------------|---|
| Tip Sizes: | .010 -.015 |
| Pressure: | As needed |
| Dilution: | Not required |
| Surface Test: | Painted surfaces may lift. Test a small area before applying over a painted finish. |

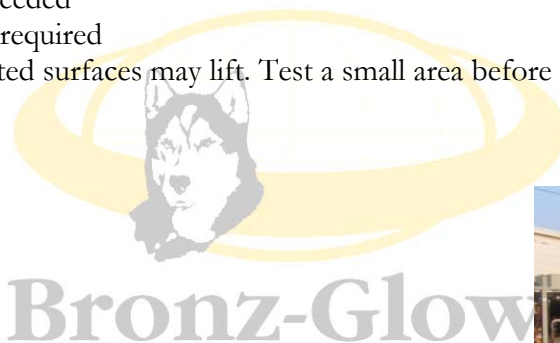

Always provide ventilation and use approved personal safety protection when handling or applying coatings.

For more detailed information, call, email, or visit our web site

Distributed by Bronz-Glow Technologies, Inc.
175 Bronz-Glow Way
St. Augustine, FL 32095
Ph: (904) 825-0175 or Fax: 904-825-0122
E-mail: Customerserv@bronz-glow.com or www.bronz-glow.com

Conditions of use: "The information, data contained herein, is believed to be reliable and based on our knowledge & experience; however, seller does not guarantee the result obtained by buyer. Seller hereby expressly disclaims any implied warranty, of merchantability for fitness for a particular purpose and / or any other warranty expressed or implied as to any and all products and / or suggestions described herein, whether such are used alone or in conjunction with other materials. Buyer must make its own determination of suitability of any products for its use and the completeness of any information. In no event shall Bronz-Glow Technologies, Inc. Holdings Trust be liable for consequential or incidental damages"